





## AP Series – Precise Current Transformers

- Precision CT's in compact packages
- Class 0.2 accuracy typical
- Excellent linearity over rated current range
- 2.5kVrms isolation
- Operating Temperature Range -40 to +85°C



### Electrical Specifications @ 20°C

Part No.	Turns	Burden( $\Omega$ )	Rated Current Amps	Max. Current Amps	Resistance( $\Omega$ ) Max.
AP-1000	1000	10	10	20	70
AP-1500	1500	15	10	20	120
AP-2000	2000	20	15	25	235
AP-2500	2500	50	15	25	330

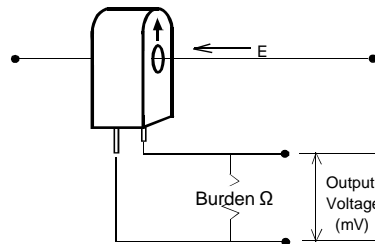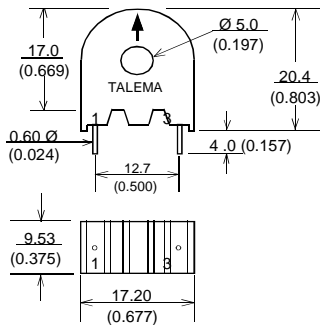

### Output Response at Rated Burden

